Asbestos Air Monitoring Report

28 January 2022

Randwick City Council
30 Frances Street
Randwick NSW 2031

Attention: Joe Santangelo
joe.santangelo@randwick.nsw.gov.au

RE: Asbestos Air Monitoring Report

Dear Joe Santangelo

Please find below Asbestos air monitoring report for:

Site:	Little Bay Beach

All works have been completed in accordance with relevant state WHS Legislation and approved Codes of Practices.

See following pages for results.

Regards,

Alex Tam
Occupational Hygienist
Licensed Asbestos Assessor #001241
28/01/2022

Requested by:	
Client Contact Name	Joe Santangelo
Client Contact Number	0436839760
Client Contact Email	joe.santangelo@randwick.nsw.gov.au
Site:	
Address	2 Coast Hospital Rd, Little Bay NSW 2036
Local Government Area	Randwick City Council
Site Boundary	
Air Monitoring Locations	

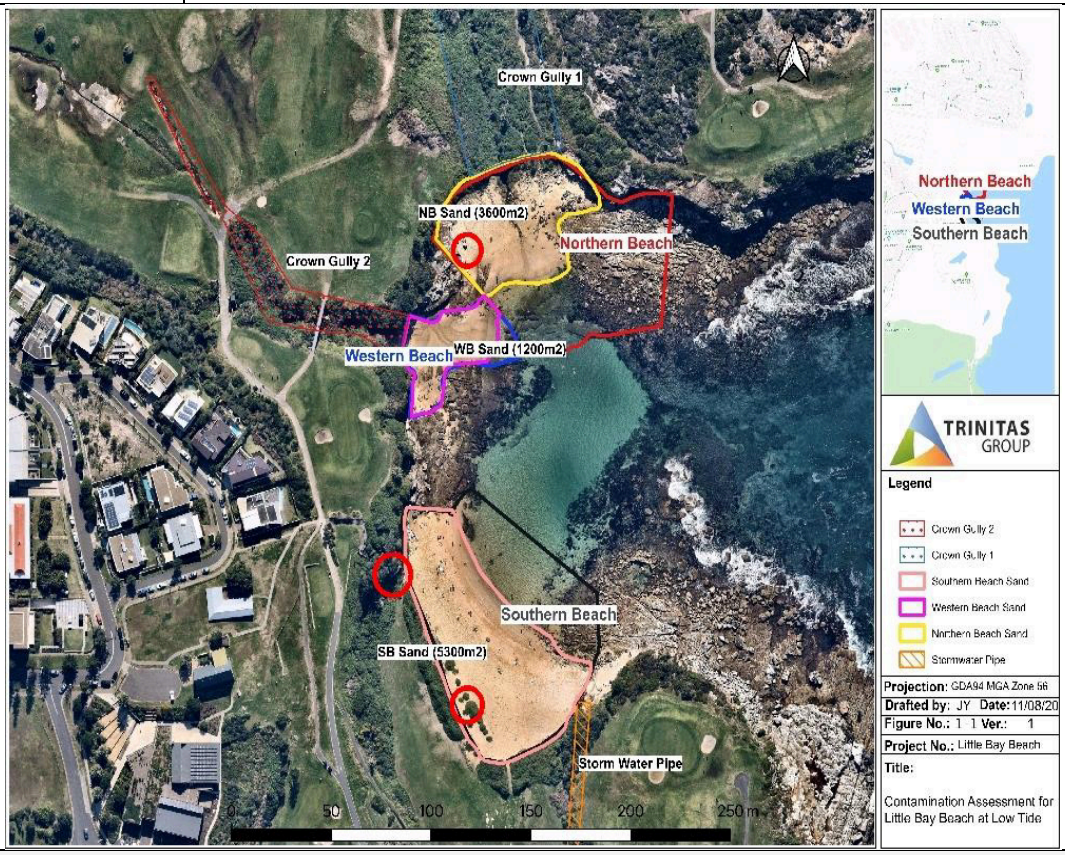

Air Monitoring Details:	
Date of Field Work:	28/01/2022
Start Time:	11:30
Trinitas Consultant:	Alex Tam Licensed Asbestos Assessor #001241
Sampling Type:	Asbestos
Temperature	25°C
Wind Speed	19km/h
Scope of Work:	Background air monitoring

Methodology:

Asbestos fibre static air monitoring and analysis was conducted in accordance with Guidance Note on the Membrane Filter Method for the Estimation of Airborne Asbestos Fibres (NOHSC:3003: April 2005) and

in-house procedures of NATA accredited laboratory for the estimation of airborne fibres.

The sample collection was performed using SKC portable sampling pumps fitted with sampling cassettes containing 25 mm membrane filters that were flow tested at the commencement and completion of sampling.

Exposure Standard

The Australian exposure standard for asbestos fibers is 0.1 fibres/ml of air and the action limit for asbestos fibres is 0.01 fibres/ml as per the NSW WHS Regulations 2017.

Sample Location / Person Name	AM Type	Sample ID	Average Flow Rate (L/Min)	Time On	Total Sampling Time (Min)	Total Volume (L)	Results
Beach entrance	B	01	4.0	11:30	150	600.00	<0.01 f/ml
Southern beach south end	B	02	4.0	11:39	137	548.00	<0.01 f/ml
Northern beach south end	B	03	4.0	11:45	128	512.00	<0.01 f/ml
Field blank	Bl	04					0 fibres / 100 fields

AM Type Legend

B= Background **Co**= Control **Cl** = Clearance **Bl**= Field Blank **Pe**= Personal

Comments/Recommendations:

All air monitoring results were below the exposure standard for asbestos fibers during removal works <0.01 f/ml
NATA accredited laboratory results are provided within **Appendix 2**.

Disclaimer:

The results within this report relate only to the sampling locations specified and their analysis. This report shall not be reproduced, except in full.

Prepared By	Approved By
Alex Tam *Occupational Hygienist* Licensed Asbestos Assessor #001241 28/01/2022	**Denny Bolatti** Principal Occupational Hygienist Licensed Asbestos Assessor 001132 01/02/2022

Appendix 1: Air Monitoring Locations

Location: Beach entrance
Result: <0.01 f/ml
Image Id: 220128-113621

Location: Southern beach south end
Result: <0.01 f/ml
Image Id: 220128-113926

Location: Northern beach south end
Result: <0.01 f/ml
Image Id: 220128-114639

Location: Field blank
Result: 0 fibres / 100 fields
Image Id: 220128-114704

How to Contact Us

Mail	Trinitas Group
	PO Box 1376 Parramatta NSW 2124
Email	admin@trinitasgroup.com.au
Address	Level 3, 24 Hunter Street, Parramatta NSW 2150
Website	www.trinitasgroup.com.au
Telephone	1800 4 TRINITAS
Facsimile	02 8016 0875

Trinitas Group Pty Ltd
ABN 12 161 759 708

Disclaimer: This report is prepared for the use of the recipient for the purpose of risk evaluation, risk improvement and or loss control. It is based upon prevailing conditions at the time of inspection, our observations and information provided by the client contact/s at the site. No responsibility is accepted, and liability disclaimed for the use of this report for any other purpose, or by any third party, nor does it imply that no other hazardous

Appendix 2: Laboratory Analysis Results

Certificate of Analysis

eurofins | Environment Testing

Trinitas Group Pty Ltd
Level 3, 24 Hunter Street
Parramatta
NSW 2150

NATA Accredited
Accreditation Number 1261
Site Number 18217

Accredited for compliance with ISO/IEC 17025–Testing
NATA is a signatory to the ILAC Mutual Recognition Arrangement for the mutual recognition of the equivalence of testing, medical testing, calibration, inspection, proficiency testing scheme providers and reference materials producers reports and certificates.

Attention:	- RESULTS/SRAs
Report	858700-AFC
Project Name	LITTLE BAY BEACH
Received Date	Jan 28, 2022
Date Reported	Jan 31, 2022

METHODOLOGY:

Asbestos Sampling	Sampling as per the National Occupational Health & Safety Commission – Guidance Note on The Membrane Filter Method For Estimating Airborne Asbestos Fibres 2nd Edition [NOHSC:3003(2005)] and the NATA Specific Accreditation Criteria, ISO/IEC 17025 Application Document Life Sciences – Annex, Asbestos sampling and testing, Issued: March 2021.
Pump Calibration	Air sampling pump performance has been assessed in accordance with Australian Institute of Occupational Hygiene (AIOH) Technical Paper Air Sampling Pumps: Equipment Calibration Requirements. Pump flow rate measurement equipment (e.g. Field Rotameter) has been calibrated in accordance with AIOH Technical Paper Flow Measurement Equipment: Calibration Requirements.
Asbestos Counting	Fibre counting is conducted in accordance with the National Occupational Health & Safety Commission Guidance Note on the Membrane Filter Method For Estimating Airborne Asbestos Fibres 2nd Edition , [NOHSC:3003(2005)] (MFM) and supplementary work instruction in-house LTM-ASB-8010. Unless specifically noted, analysis is undertaken by approved analysts at the base facility. Fibre counts (Fibres/fields) are covered by the facility's NATA scope of accreditation. The requirements of the NATA Specific Accreditation Criteria, ISO/IEC 17025 Application Document Life Sciences – Annex, Asbestos sampling and testing, Issued: March 2021 are realised.

Project Name LITTLE BAY BEACH
Project ID
Date Sampled Jan 28, 2022
Report 858700-AFC

Eurofins Sample No.	Client Sample ID	Pump ID	Location	Start (time)	End (time)	Start Flow Rate (L/min)	End Flow Rate (L/min)	Result (Fibres/Fields)	Result (Fibres/mL)
22-Ja34654	1	TGP07	BEACH ENTRANCE	11:30	14:00	4.0	4.0	0/100	< 0.01
22-Ja34655	2	TGP06	SOUTHERN BEACH SOUTH END	11:39	13:56	4.0	4.0	0/100	< 0.01
22-Ja34656	3	TGP15	NORTHERN BEACH SOUTH END	11:45	13:53	4.0	4.0	0/100	< 0.01
22-Ja34657	4	--	BLANK	--	--	--	--	0/100	--

Sample History

Where samples are submitted/analysed over several days, the last date of extraction is reported.

If the date and time of sampling are not provided, the Laboratory will not be responsible for compromised results should testing be performed outside the recommended holding time.

Description	Testing Site	Extracted	Holding Time
Asbestos - LTM-ASB-8010	Sydney	Jan 28, 2022	Indefinite

eurofins | Environment Testing

web: www.eurofins.com.au
email: EnviroSales@eurofins.com

Eurofins Environment Testing Australia Pty Ltd
ABN: 50 005 085 521

Melbourne
6 Monterey Road
Dandenong South VIC 3175
Phone : +61 3 8564 5000
NATA # 1261 Site # 1254

Sydney
Unit F3, Building F
16 Mars Road
Lane Cove West NSW 2066
Phone : +61 2 9900 8400
NATA # 1261 Site # 18217

Brisbane
1/21 Smallwood Place
Murarrie QLD 4172
Phone : +61 7 3902 4600
NATA # 1261 Site # 20794

Newcastle
4/52 Industrial Drive
Mayfield East NSW 2304
PO Box 60 Wickham 2293
Phone : +61 2 4968 8448
NATA # 1261 Site # 25079

Eurofins ARL Pty Ltd
ABN: 91 05 0159 898

Perth
46-48 Banksia Road
Welshpool WA 6106
Phone : +61 8 6253 4444
NATA # 2377 Site # 2370

Eurofins Environment Testing NZ Limited
NZBN: 9429046024954

Auckland
35 O'Rorke Road
Penrose, Auckland 1061
Phone : +64 9 526 45 51
IANZ # 1327

Christchurch
43 Detroit Drive
Rolleston, Christchurch 7675
Phone : 0800 856 450
IANZ # 1290

Company Name: Trinitas Group Pty Ltd
Address: Level 3, 24 Hunter Street
Parramatta
NSW 2150

Project Name: LITTLE BAY BEACH

Order No.:
Report #: 858700
Phone: 02 8810 4445
Fax: 02 8016 0875

Received: Jan 28, 2022 3:10 PM
Due: Jan 31, 2022
Priority: 1 Day
Contact Name: - RESULTS/SRAs

Eurofins Analytical Services Manager : John Nguyen

Sample Detail						Asbestos Fibre Count & Concentration
Melbourne Laboratory - NATA # 1261 Site # 1254						
Sydney Laboratory - NATA # 1261 Site # 18217						X
Brisbane Laboratory - NATA # 1261 Site # 20794						
Mayfield Laboratory - NATA # 1261 Site # 25079						
Perth Laboratory - NATA # 2377 Site # 2370						
External Laboratory						
No	**Sample ID**	**Sample Date**	**Sampling Time**	**Matrix**	**LAB ID**	
1	1	Jan 28, 2022	2:00PM	Air	S22-Ja34654	X
2	2	Jan 28, 2022	1:56PM	Air	S22-Ja34655	X
3	3	Jan 28, 2022	1:53PM	Air	S22-Ja34656	X
4	4	Jan 28, 2022		Air	S22-Ja34657	X
Test Counts						4

Internal Quality Control Review and Glossary General

1. QC data may be available on request.
2. All soil results are reported on a dry basis, unless otherwise stated.
3. Samples were analysed on an 'as received' basis.
4. Information identified on this report with the colour **blue** indicates data provided by customer that may have an impact on the results.
5. Information identified on this report with the colour **orange** indicates sections of the report not covered by the laboratory's scope of NATA accreditation.
6. This report replaces any interim results previously issued.

Holding Times

Please refer to the most recent version of the 'Sample Preservation and Container Guide' for holding times (QS3001).
If the Laboratory did not receive the information in the required timeframe, and regardless of any other integrity issues, suitably qualified results may still be reported. Holding times apply from the date of sampling, therefore compliance to these may be outside the laboratory's control.

Units

% w/w:	Percentage weight-for-weight basis, e.g. of asbestos in asbestos-containing finds in soil samples (**% w/w**)
F/fld	Airborne fibre filter loading as Fibres (**N**) per Fields counted (**n**)
F/mL	Airborne fibre reported concentration as Fibres per millilitre of air drawn over the sampler membrane (**C**)
g, kg	Mass, e.g. of whole sample (**M**) or asbestos-containing find within the sample (**m**)
g/kg	Concentration in grams per kilogram
L, mL	Volume, e.g. of air as measured in AFM (**V** = **r** x **t**)
L/min	Airborne fibre sampling Flowrate as litres per minute of air drawn over the sampler membrane (**r**)
min	Time (**t**), e.g. of air sample collection period

Calculations

Airborne Fibre Concentration: $C = \frac{}{a} \times \frac{}{n} \times \frac{}{r} \times \frac{}{t} = K \times \frac{}{n} \times \frac{}{V}$

Asbestos Content (as asbestos): $\%\ w/w = \frac{(m \times PA)}{M}$

Weighted Average (of asbestos): $\%_W = \Sigma \frac{(m \times P_A)_X}{X}$

Terms

%asbestos	Estimated percentage of asbestos in a given matrix. May be derived from knowledge or experience of the material, informed by HSG264 *Appendix 2*, else assumed to be 15% in accordance with WA DOH *Appendix 2* (**P_A**).
ACM	Asbestos Containing Materials. Asbestos contained within a non-asbestos matrix, typically presented in bonded (non-friable) condition. For the purposes of the NEPM and WA DOH, ACM corresponds to material larger than 7 mm x 7 mm.
AF	Asbestos Fines. Asbestos contamination within a soil sample, as defined by WA DOH. Includes loose fibre bundles and small pieces of friable and non-friable material such as asbestos cement fragments mixed with soil. Considered under the NEPM as equivalent to "non-bonded / friable".
AFM	Airborne Fibre Monitoring, e.g. by the MFM.
Amosite	Amosite Asbestos Detected. Amosite may also refer to Fibrous Grunerite or Brown Asbestos. Identified in accordance with AS 4964-2004.
AS	Australian Standard.
Asbestos Content (as asbestos)	Total % w/w asbestos content in asbestos-containing finds in a soil sample (**% w/w**).
Chrysotile	Chrysotile Asbestos Detected. Chrysotile may also refer to Fibrous Serpentine or White Asbestos. Identified in accordance with AS 4964-2004.
COC	Chain of Custody.
Compliant	Indicates the item has been assessed against the relevant criteria, e.g. NATA SAC_07.
Crocidolite	Crocidolite Asbestos Detected. Crocidolite may also refer to Fibrous Riebeckite or Blue Asbestos. Identified in accordance with AS 4964-2004.
Dry	Sample is dried by heating prior to analysis.
DS	Dispersion Staining. Technique required for Unequivocal Identification of asbestos fibres by PLM.
FA	Fibrous Asbestos. Asbestos containing material that is wholly or in part friable, including materials with higher asbestos content with a propensity to become friable with handling, and any material that was previously non-friable and in a severely degraded condition. For the purposes of the NEPM and WA DOH, FA generally corresponds to material larger than 7 mm x 7 mm, although FA may be more difficult to visibly distinguish and may be assessed as AF.
Fibre Count	Total of all fibres (whether asbestos or not) meeting the counting criteria set out in the NOHSC:3003
Fibre ID	Fibre Identification. Unequivocal identification of asbestos fibres according to AS 4964-2004. Includes Chrysotile, Amosite (Grunerite) or Crocidolite asbestos.
Friable	Asbestos-containing materials of any size that may be broken or crumbled by hand pressure. For the purposes of the NEPM, this includes both AF and FA. It is outside of the laboratory's remit to assess degree of friability.
HSG248	UK HSE HSG248, *Asbestos: The Analysts Guide*, 2nd Edition (2021).
HSG264	UK HSE HSG264, *Asbestos: The Survey Guide* (2012).
ISO (also ISO/IEC)	International Organization for Standardization / International Electrotechnical Commission.
K Factor	Microscope constant (**K**) as derived from the effective filter area of the given AFM membrane used for collecting the sample (**A**) and the projected eyepiece graticule area of the specific microscope used for the analysis (**a**).
LOR	Limit of Reporting.
MFM (also NOHSC:3003)	Membrane Filter Method. As described by the Australian Government National Occupational Health and Safety Commission, *Guidance Note on the Membrane Filter Method for Estimating Airborne Asbestos Fibres*, 2nd Edition [NOHSC:3003(2005)].
N/A	Not Applicable. Indicates a result or assessment is not required or applicable to that item.
NATA	National Association of Testing Authorities, Australia.
NEPM (also ASC NEPM)	National Environment Protection (Assessment of Site Contamination) Measure, (2013, as amended).
Organic	Organic Fibres Detected. Organic may refer to Natural or Man-Made Polymeric Fibres. Identified in accordance with AS 4964-2004.
PCM	Phase Contrast Microscopy. As used for Fibre Counting according to the MFM.
PLM	Polarised Light Microscopy. As used for Fibre Identification and Trace Analysis according to AS 4964-2004.
SAC_07	Specific Accreditation Criteria: ISO/IEC 17025 Application Document, Life Sciences – Annex, Asbestos sampling and testing.
SMF	Synthetic Mineral Fibre Detected. SMF may also refer to Man Made Vitreous Fibres. Identified in accordance with AS 4964-2004.
SRA	Sample Receipt Advice.
Trace Analysis	Analytical procedure used to detect the presence of respirable fibres (particularly asbestos) in a given sample matrix.
UK HSE HSG	United Kingdom, Health and Safety Executive, Health and Safety Guidance, publication.
UMF	Unidentified Mineral Fibre Detected. Fibrous minerals that are detected but have not been unequivocally identified by PLM with DS according the AS 4964-2004. May include (but not limited to) Actinolite, Anthophyllite or Tremolite asbestos.
WA DOH	Reference document for the NEPM. Government of Western Australia, *Guidelines for the Assessment, Remediation and Management of Asbestos- Contaminated Sites in Western Australia* (updated 2021), including Appendix Four: *Laboratory analysis*
Weighted Average	Combined average % w/w asbestos content of all asbestos-containing finds in the given aliquot or total soil sample (**$\%_{WA}$**).

Comments

Volume Measurement : Alex Tam, Trinitas Group Pty Ltd, has been trained by Eurofins and they conducted the sampling in accordance with the National Occupational Health & Safety Commission - Guidance Note on The Membrane Filter Method For Estimating Airborne Asbestos Fibres 2nd Edition [NOHSC:3003(2005)]methodology. Sampling pumps used by Trinitas Group Pty Ltd were calibrated by Eurofins Environment Testing and therefore volume measurements contained in this report are traceable back to Eurofins Environment Testing. Eurofins Environment Testing are responsible for all data contained in this report.

Sample Integrity

Custody Seals Intact (if used)	N/A
Attempt to Chill was evident	N/A
Sample correctly preserved	Yes
Appropriate sample containers have been used	Yes
Sample containers for volatile analysis received with minimal headspace	Yes
Samples received within HoldingTime	Yes
Some samples have been subcontracted	No

Asbestos Counter/Identifier:

Sayeed Abu	Senior Analyst-Asbestos (NSW)

Authorised by:

Chamath JHM Annakkage	Senior Analyst-Asbestos (NSW)

Glenn Jackson
General Manager

Final Report – this report replaces any previously issued Report

- Indicates Not Requested

* Indicates NATA accreditation does not cover the performance of this service

Measurement uncertainty of test data is available on request or please click here.

Eurofins shall not be liable for loss, cost, damages or expenses incurred by the client, or any other person or company, resulting from the use of any information or interpretation given in this report. In no case shall Eurofins be liable for consequential damages including, but not limited to, lost profits, damages for failure to meet deadlines and lost production arising from this report. This document shall not be reproduced except in full and relates only to the items tested. Unless indicated otherwise, the tests were performed on the samples as received.