

13 April 2023

Randwick City Council 30 Frances Street Randwick NSW 2031

Attention: Ryan Zammit ryan.zammit@randwick.nsw.gov.au

# **RE: Asbestos Air Monitoring Report**

Dear Ryan Zammit

Please find below Asbestos air monitoring report for:

Site:	Little Bay Beach
Location:	Background air monitoring

All works have been completed in accordance with relevant state WHS Legislation and approved Codes of Practices.

See following pages for results.

Regards,

Aleston

Alex Tam Licensed Asbestos Assessor 001241 Senior Occupational Hygienist 13/04/2023







Requested by:	
Client Contact Name	Ryan Zammit
Client Contact Number	90936744
Client Contact Email	ryan.zammit@randwick.nsw.gov.au
Site:	
Address	2 Coast Hospital Rd, Little Bay NSW 2036
Local Government Area	Randwick City Council
Site Boundary	
Air Monitoring Locations	0
	Crown Gully 1         Northern Beach         Western Beach         Western Beach         Western Beach         Suthern Beach         Suthern Beach         Suthern Beach         Bismention         Assessment for         There         Commany 200
Air Monitoring Details:	
Date of Field Work:	13/04/2023
Start Time:	09:45
rinitas Consultant:	Alex Tam Senior Occupational Hygienist
	Ashastas
Sampling Type:	Asbestos 17°C



LOCAL GOVERNMENT PROCUREMENT






Wind Speed 9k	9km/h								
Scope of Work: Ba									
Methodology:									
Asbestos fibre static air monitoring and analysis was conducted in accordance with Guidance Note on the									
Membrane Filter Method for t	he Estim	nation of Airborn	e Asbestos	s Fibres (N	IOHSC:30	03: April 2	005) and		
in-house procedures of NATA	accred	ited laboratory for	or the estin	nation of a	irborne fib	res.			
The sample collection was pe									
containing 25 mm membrane	filters th	hat were flow tes	sted at the	commence	ement and	completio	n of		
sampling.									
Exposure Standard							-		
The Australian exposure stan					and the a	ction limit	for		
asbestos fibres is 0.01 fibres/	ml as pe	er the NSW WH	S Regulation	ons 2017.					
2		_	e		b u g	(L)			
Sample -ocation Person Vame	Type	Sample ID	Ige (1	On	(Min		ts		
Sample Locatio Person Name	Ĥ	du	era w Mir	ne	tal mp	Total Volume	Results		
L Sa Pei Na	MΑ	Sai	Average Flow Rate (L/Min)	Time	Total Sampling Time (Min)	Total Volun	Re		
Beach entrance	В	DH062407	4.0	09:45	134	536.00	<0.01 f/ml		
Southern beach south end	В	DH062420	4.0	09:51	133	532.00	<0.01 f/ml		
Southern beach north end	В	DH062654	4.0	09:55	133	532.00	<0.01 f/ml		
Field Blank	BI	DH062009					0 fibres / 100 fields		
AM Type Legend							Too heids		
<b>B</b> = Background <b>Co</b> = Con	trol	CI = Clearance	BI= F	Field Blank	Pe=	Personal			
Comments/Recommendatio		01000.00100							
All air monitoring results were		ne exposure sta	ndard for a	sbestos fil	pers during	removal v	vorks <0.01		
f/ml						,			
NATA accredited laboratory r	esults ai	e provided with	in <b>Append</b>	ix 2.					
Disclaimer:		•							
The results within this report	elate on	ly to the sampli	ng location	s specified	d and their	analysis.	This report		
shall not be reproduced, exce	pt in full		-	-		-	-		
Prepared By Approved By									
		$\sim \cap \sim$	~						
AL 1			NA	\ \					
Alebhan		(1Kt)	Lo AA	·					
120	J. Korr								
Alex Tam	004044		Denny Bolatti						
Licensed Asbestos Assessor		Principal Occupational Hygienist							
Senior Occupational Hygienis	L		Licensed Asbestos Assessor 001132						
13/04/2023 15/04/2023									





# **Appendix 1: Air Monitoring Locations**

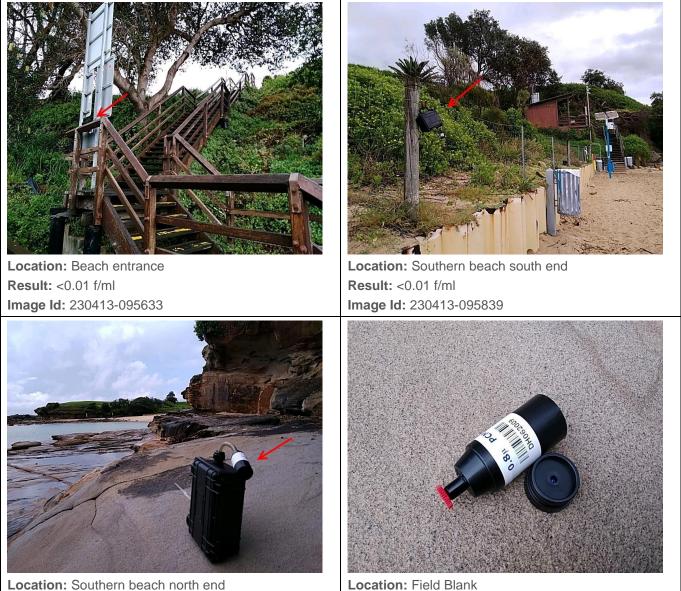

Location: Southern beach north e Result: <0.01 f/ml Image Id: 230413-100105

Location: Field Blank Result: 0 fibres / 100 fields Image Id: 230413-100109







### How to Contact Us

Mail	Trinitas Group
	PO Box 1376 Parramatta NSW 2124
Email	admin@trinitasgroup.com.au
Address	Level 3, 24 Hunter Street, Parramatta NSW 2150
Website	www.trinitasgroup.com.au
Telephone	1800 4 TRINITAS
Facsimile	02 8016 0875

### **Trinitas Group Pty Ltd**

ABN 12 161 759 708

Disclaimer: This report is prepared for the use of the recipient for the purpose of risk evaluation, risk improvement and or loss control. It is based upon prevailing conditions at the time of inspection, our observations and information provided by the client contact/s at the site. No responsibility is accepted, and liability disclaimed for the use of this report for any other purpose, or by any third party, nor does it imply that no other hazardous







Appendix 2: Laboratory Analysis Results







# Certificate of Analysis

Trinitas Group Pty Ltd Level 3, 24 Hunter Street Parramatta NSW 2150



**Environment Testing** 

NATA Accredited Accreditation Number 1261 Site Number 18217

Accredited for compliance with ISO/IEC 17025–Testing NATA is a signatory to the ILAC Mutual Recognition Arrangement for the mutual recognition of the equivalence of testing, medical testing, calibration, inspection, proficiency testing scheme providers and reference materials producers reports and certificates.

Attention:	Denny Bolatti
Report	980785-AFA
Project Name	LITTLE BAY BEACH
Received Date	Apr 13, 2023
Date Reported	Apr 14, 2023

### **METHODOLOGY:**

Asbestos Counting

Conducted in accordance with the National Occupational Health & Safety Commission -Guidance Note on The Membrane Filter Method For Estimating Airborne Asbestos Fibres 2nd Edition [NOHSC:3003(2005)] and in-house Method LTM-ASB-8010.



# Project NameLITTLE BAY BEACHProject IDProject IDDate SampledApr 13, 2023Report980785-AFA

Eurofins Sample No.	Client Sample ID	Location	Fibres/100 fields
23-Ap0028104	DH062009	BLANK	2/100
23-Ap0028105	DH062407	BEACH ENTRANCE	0/100
23-Ap0028106	DH062420	SOUTHERN BEACH SOUTH END	0/100
23-Ap0028107	DH062654	SOUTHERN BEACH NORTH END	0/100



### **Sample History**

Where samples are submitted/analysed over several days, the last date of extraction is reported.

If the date and time of sampling are not provided, the Laboratory will not be responsible for compromised results should testing be performed outside the recommended holding time.

### Description

Asbestos - LTM-ASB-8010

Testing SiteExtractedSydneyApr 14, 2023

Holding Time Indefinite

		<b>C!</b>	Eurofins Env ABN: 50 005 08		nt Testing Australia I	Pty Ltd					Eurofins ARL Pty Ltd ABN: 91 05 0159 898	Eurofins Environment Testing NZ Ltd NZBN: 9429046024954	
Melbourne         Geelong         Sydney           6 Monterey Road         19/8 Lewalan Street         179 Magow           Dandenong South         Grovedale         Girraween           VIC 3175         VIC 3216         NSW 2145           Tel: +61 3 8564 5000         Tel: +61 3 8564 5000         Tel: +61 2			n Mitchell Murarrie Mayfield West NSW 2304		Perth 46-48 Banksia Road Welshpool WA 6106 Tel: +61 8 6253 4444 NATA# 2377 Site# 2370	Auckland 35 O'Rorke Road Penrose, Auckland 1061 Tel: +64 9 526 45 51 IANZ# 1327	Christchurch 43 Detroit Drive Rolleston, Christchurch 7675 Tel: 0800 856 450 IANZ# 1290						
Company Name:       Trinitas Group Pty Ltd         Address:       Level 3, 24 Hunter Street         Parramatta       NSW 2150						Phone: 02	0785 8810 4445 8016 0875		Received: Due: Priority: Contact Name:	Apr 13, 2023 10:14 Apr 14, 2023 1 Day Denny Bolatti	PM		
Pro	oject Name:	LITTLE BAY	/ BEACH								Eurofins Analytical	Services Manager	: Bonnie Pu
Sample Detail					Asbestos (amount of fibres in air)								
Sydney Laboratory - NATA # 1261 Site # 18217					х								
No	rnal Laboratory Sample ID	Sample Date	Sampling Time	Ma	atrix LAB	ID							
1	DH062009	Apr 13, 2023		Air	S23-Ap0	028104	х						
2	DH062407	Apr 13, 2023	11:59AM	Air	S23-Ap0		Х						
3	DH062420	Apr 13, 2023	12:04PM	Air	S23-Ap0	028106	Х						
4	DH062654	Apr 13, 2023	12:08PM	Air	S23-Ap0	028107	Х						
Test	Counts						4						



### Internal Quality Control Review and Glossary General

- 1. 2. 3.
- AC data may be available on request. All soil results are reported on a dry basis, unless otherwise stated. Samples were analysed on an 'as received' basis. Information identified on this report with the colour **blue** indicates data provided by customer that may have an impact on the results. This report replaces any interim results previously issued. 4. 5.

Holding Times Please refer to the most recent version of the 'Sample Preservation and Container Guide' for holding times (QS3001).

If the Laboratory did not receive the information in the required timeframe, and regardless of any other integrity issues, suitably qualified results may still be reported. Holding times apply from the date of sampling, therefore compliance to these may be outside the laboratory's control.

Units	
% w/w:	Percentage weight-for-weight basis, e.g. of asbestos in asbestos-containing finds in soil samples (% w/w)
F/fld	Airborne fibre filter loading as Fibres (N) per Fields counted (n)
F/mL g, kg	Airborne fibre reported concentration as Fibres per millilitre of air drawn over the sampler membrane (C) Mass, e.g. of whole sample (M) or asbestos-containing find within the sample (m)
g/kg	Concentration in grams per kilogram
Ĺ, mL	Volume, e.g. of air as measured in AFM (V = r x t)
L/min min	Airborne fibre sampling Flowrate as litres per minute of air drawn over the sampler membrane (r) Time (t), e.g. of air sample collection period
Calculations	
Airborne Fibre Concentration:	$C = \left(\frac{A}{a}\right) \times \left(\frac{N}{n}\right) \times \left(\frac{1}{r}\right) \times \left(\frac{1}{t}\right) = K \times \left(\frac{N}{n}\right) \times \left(\frac{1}{v}\right)$
Asbestos Content (as asbestos):	$\% w/w = \frac{(m \times P_A)}{M}$
Weighted Average (of asbestos):	$\mathscr{H}_{WA} = \sum \frac{(m \times P_A)_x}{x}$
Terms	
%asbestos	Estimated percentage of asbestos in a given matrix. May be derived from knowledge or experience of the material, informed by HSG264 Appendix 2, else assumed to be 15% in accordance with WA DOH Appendix 2 (P <sub>A</sub> ).
ACM	Asbestos Containing Materials. Asbestos contained within a non-asbestos matrix, typically presented in bonded (non-friable) condition. For the purposes of the NEPM and WA DOH, ACM corresponds to material larger than 7 mm x 7 mm.
AF	Asbestos Fines. Asbestos contamination within a soil sample, as defined by WA DOH. Includes loose fibre bundles and small pieces of friable and non-friable
4.54	material such as asbestos cement fragments mixed with soil. Considered under the NEPM as equivalent to "non-bonded / friable".
AFM	Airborne Fibre Monitoring, e.g. by the MFM.
Amosite	Amosite Asbestos Detected. Amosite may also refer to Fibrous Grunerite or Brown Asbestos. Identified in accordance with AS 4964-2004.
AS	Australian Standard.
	c) Total % w/w asbestos content in asbestos-containing finds in a soil sample (% w/w). Charactile Asbestos Detected Charactile may also refer to Eitraus Serencting or White Asbestos I deptified in assordance with AS 4064 2004.
Chrysotile COC	Chrysotile Asbestos Detected. Chrysotile may also refer to Fibrous Serpentine or White Asbestos. Identified in accordance with AS 4964-2004.
Crocidolite	Chain of Custody.
	Crocidolite Asbestos Detected. Crocidolite may also refer to Fibrous Riebeckite or Blue Asbestos. Identified in accordance with AS 4964-2004. Sample is dried by heating prior to analysis.
Dry DS	
FA	Dispersion Staining. Technique required for Unequivocal Identification of asbestos fibres by PLM.
FA	Fibrous Asbestos. Asbestos containing material that is wholly or in part friable, including materials with higher asbestos content with a propensity to become friable with handling, and any material that was previously non-friable and in a severely degraded condition. For the purposes of the NEPM and WA DOH, FA generally corresponds to material larger than 7 mm x 7 mm, although FA may be more difficult to visibly distinguish and may be assessed as AF.
Fibre Count	Total of all fibres (whether asbestos or not) meeting the counting criteria set out in the NOHSC:3003
Fibre ID	Fibre Identification. Unequivocal identification of asbestos fibres according to AS 4964-2004. Includes Chrysotile, Amosite (Grunerite) or Crocidolite asbestos.
Friable	Asbestos-containing materials of any size that may be broken or crumbled by hand pressure. For the purposes of the NEPM, this includes both AF and FA. It is outside of the laboratory's remit to assess degree of friability.
HSG248	UK HSE HSG248, Asbestos: The Analysts Guide, 2nd Edition (2021).
HSG264	UK HSE HSG264, Asbestos: The Survey Guide (2012).
ISO (also ISO/IEC)	International Organization for Standardization / International Electrotechnical Commission.
K Factor	Microscope constant (K) as derived from the effective filter area of the given AFM membrane used for collecting the sample (A) and the projected eyepiece graticule area of the specific microscope used for the analysis (a).
LOR	Limit of Reporting.
MFM (also NOHSC:3003)	Membrane Filter Method. As described by the Australian Government National Occupational Health and Safety Commission, Guidance Note on the Membrane Filter Method for Estimating Airborne Asbestos Fibres, 2nd Edition [NOHSC:3003(2005)].
NEPM (also ASC NEPM)	National Environment Protection (Assessment of Site Contamination) Measure, (2013, as amended).
Organic	Organic Fibres Detected. Organic may refer to Natural or Man-Made Polymeric Fibres. Identified in accordance with AS 4964-2004.
PCM	Phase Contrast Microscopy. As used for Fibre Counting according to the MFM.
PLM	Polarised Light Microscopy. As used for Fibre Identification and Trace Analysis according to AS 4964-2004.
Sampling	Unless otherwise stated Eurofins are not responsible for sampling equipment or the sampling process.
SMF	Synthetic Mineral Fibre Detected. SMF may also refer to Man Made Vitreous Fibres. Identified in accordance with AS 4964-2004.
SRA	Sample Receipt Advice.
Trace Analysis	Analytical procedure used to detect the presence of respirable fibres (particularly asbestos) in a given sample matrix.
UK HSE HSG	United Kingdom, Health and Safety Executive, Health and Safety Guidance, publication.
UMF	Unidentified Mineral Fibre Detected. Fibrous minerals that are detected but have not been unequivocally identified by PLM with DS according the AS 4964-2004. May include (but not limited to) Actinolite, Anthophyllite or Tremolite asbestos.
WA DOH	Reference document for the NEPM. Government of Western Australia, Guidelines for the Assessment, Remediation and Management of Asbestos- Contaminated Sites in Western Australia (updated 2021), including Appendix Four: Laboratory analysis
Weighted Average	Combined average % w/w asbestos content of all asbestos-containing finds in the given aliquot or total soil sample (%wa).



### Comments

Sample Integrity	
Custody Seals Intact (if used)	N/A
Attempt to Chill was evident	N/A
Sample correctly preserved	Yes
Appropriate sample containers have been used	Yes
Sample containers for volatile analysis received with minimal headspace	Yes
Samples received within HoldingTime	Yes
Some samples have been subcontracted	No

### Asbestos Counter/Identifier:

Bennel Jiri

Senior Analyst-Asbestos

### Authorised by:

Sayeed Abu

Senior Analyst-Asbestos

li falle

Glenn Jackson General Manager

Final Report – this report replaces any previously issued Report

- Indicates Not Requested

\* Indicates NATA accreditation does not cover the performance of this service

Measurement uncertainty of test data is available on request or please click here.

Eurofins shall not be liable for loss, cost, damages or expenses incurred by the client, or any other person or company, resulting from the use of any information or interpretation given in this report. In no case shall Eurofins be liable for consequential damages including, but not limited to, lost profits, damages for failure to meet deadlines and lost production arising from this report. This document shall not be reproduced except in full and relates only to the items tested. Unless indicated otherwise, the tests were performed on the samples as received.